

BEFORE YOU START

- 1. Obtain the correct replacement fuse kit
 - a. MM100 Replacement Fuse Kit Part #: 69193
 - b. MM200 Replacement Fuse Kit Part #: 69194
 - c. MM1000/1300/2000/2300/6000 F 440mA/1000V Fuse Part #: 69192
 - d. MM1000/1300/2000/2300/6000 F 11A/1000V Fuse Part #: 69191
- 2. Required Tools
 - a. Small Phillips screwdriver No. 1 Phillips

FUSE REPLACEMENT PROCEDURE (MM100 & MM200)

- 1. Ensure the meter is in the Off position and the unit is face up with the bottom of the unit facing away from you
- 2. Remove the rubber boot:
 - a. Begin with the bottom of the unit and remove the bottom corners of the orange boot
 - b. Next, remove the lip of the orange boot from the groove on each side of the meter
 - c. Carefully remove the orange boot to prevent tearing as the boot may stick to the meter



(2a)



(2b)








- 3. With the boot completely off:
 - a. Remove the batter cover screw, disconnect and remove the battery
 - b. Remove the two rear case cover screws
 - c. Carefully separate the front and rear cases starting with the bottom of the unit. *Note: the top of the unit is secured with plastic tabs. Use care when sliding the top of the two cases apart*



4. Remove and replace defective fuses

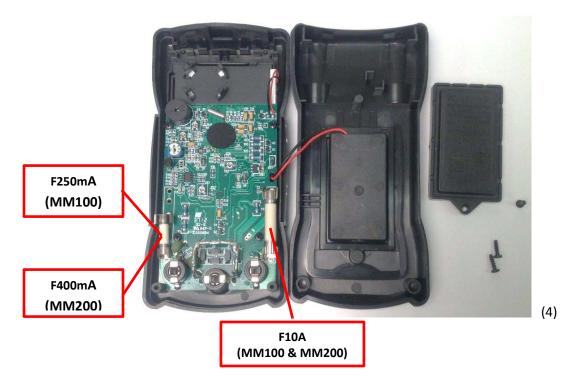



FUSE REPLACEMENT PROCEDURE (MM1000/MM1300/MM2000/MM2300/MM6000)

- 1. Ensure the meter is in the Off position.
 - a. Place the unit face down with the bottom of the unit facing away from you
 - b. Extend the meter kickstand





(1b)

- 2. To remove the rubber boot:
 - a. Place your thumbs on the back of the unit with your fingers firmly on the boot corners.

(1a)

b. While pulling back on the corners, press your thumbs against the unit, and continue until the boot is completely removed.






(2a)



3. Remove battery/fuse cover screw and battery door.

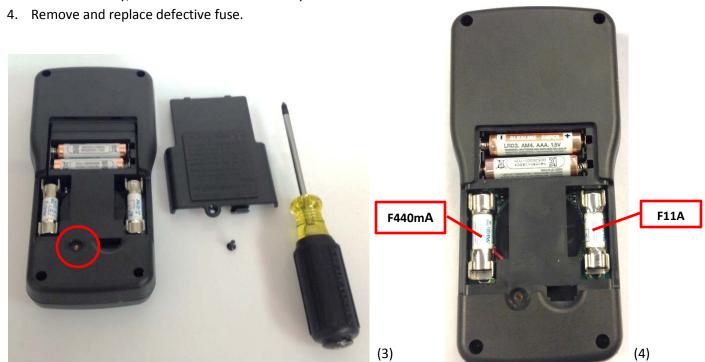

KLEIN TOOLS METER SUPPORT

Please contact Klein Tools Meter Support with any question at 1-877-775-5346.